


David E. Wallace & Co. LLC

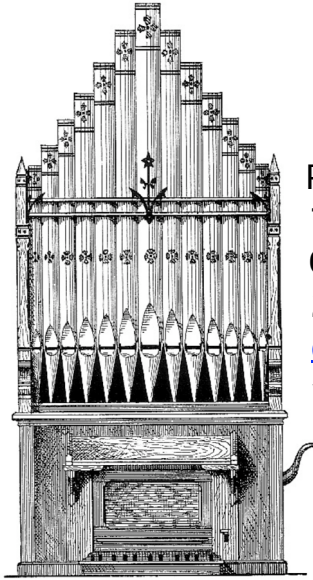

Pipe Organ Building and Restoration
147 County Road
Gorham, ME 04038-1916
207-839-7621
deworgns@aol.com
www.wallacepipeorgans.com

HISTORIC PIPE ORGANS FOR SALE

Hook & Hastings Co. opus 1573 c.1893
Rebuilt by Andover Organ Co. 1964*

Formerly of St. Dominic's Roman Catholic Church
Portland, Maine

In Storage Portland, Maine

Present Specification

Great 58 notes (Barker assist bottom 2 octaves)

18' Open Diapason (wood & metal)

8' Open Diapason

8' Viola da Gamba

8' Doppelflute

4' Octave

3' Twelfth

2' Fifteenth
III Mixture
8' Trumpet

Swell 58 notes (Barker assist bottom 2 octaves)

16' Bourdon (wood)
8' Stopped Diapason (w & m)
8' Viola
8' Voix Celeste (TC)*
4' Principalfloete*
2' Flautino
III Scharf*
8' Oboe
4' Clarion*

Original Spec:

16' Bourdon
8' Violin Diapason
8' Viola
8' Stopped Diapason
4' Violina
4' Flauto Traverso
2' Flautino
8' Conopean
8' Oboe

Choir 58 notes

8' Copula (w)*
4' Flute d'Amour
2 2/3' Nasard*
2' Piccolo
1 3/5' Tierce*
8' Clarinet (TC)

Original Spec:

8' Geigen Principal
8' Dulciana
8' Melodia
4' Flute D'Amour
2' Piccolo
8' Clarinet

Pedal 27 Notes

16' Open Diapason (w)
16' Bourdon (w)
8' Violoncello (m)

Couplers:

Swell to Great
Swell to Choir
Choir to Great
Great to Pedal
Swell to Pedal
Choir to Pedal

Combinations:

2 Unlabeled toe pedals

Great Piano, Great forte

Great to Pedal Reversible

Balanced Swell pedal

Wind indicator.

The console is a detached reversed console fully mechanical action.

The space requirements are:

24' 6" high

19' 4" wide

9' 7" deep

7' 6" additional depth for the console

Original blower not saved. Different blower is available.

The organ is very large scale. It was built and voiced for a very large church that seated over 2000 people.

The organ was in good playing condition and voice when it was removed to storage in 2001 when the building was sold. Some of the façade pipes have been damaged in storage. In addition to a thorough cleaning, the reservoir will need to be releathered, some runs of trackers will need to be replaced. The windchests need to be checked for possible retabling. The pipes and small parts are packed in pipe trays suitable for shipping.

Asking price is \$50,000.

Please contact us for additional details.



